HS-420I/M Intrinsically Safe Accelerometer 4-20mA velocity output via 2 Pin MS Connector


Key Features

- Intrinsically Safe with European, USA, Australian, South African, and Indian approvals
- Approved SIL 2 and SIL 3
- For use with PLC/DCS systems
- · Customisable features

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



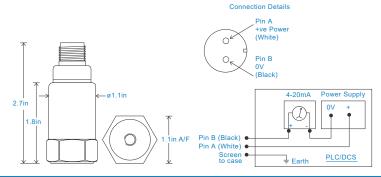

Technical Performance

Mounted Base Resonance	e 5kHz min
Velocity Ranges	see: 'How To Order' table ±10%
	Nominal 80Hz at 72°F
Frequency Response	600cpm (10Hz) to 60kcpm (1kHz) ± 5% - ISO10816
Isolation	Base isolated
Range	50g peak
Transverse Sensitivity	Less than 5%

Mechanical

Case Material	Stainless Steel
Sensing Element/Construction	PZT/Compression
Mounting Torque	5.9ft. lbs
Weight	5.2 oz. (nominal)
Sheilded Cable Asssembly	see: www.hansfordsensors.com for options
Connector	HS-AA004 - non-booted
	HS-AA053 or HS-AA054 - booted
Mounting Threads	see: 'How To Order' table


Electrical

Current Output 4-20mA DC proportional to Velocity Range 15-30 Volts DC (for 4-20mA) Supply Voltage Settling Time 2 seconds **Output Impedance** Loop Resistance 600 Ohms max. at 24 Volts >108 Ohms at 500 Volts Case Isolation

Environmental

Operating Temperature Range	see: attached certification details
Sealing	IP68
Maximum Shock	5000g
EMC	EN61326-1:2013

Typical Frequency Response

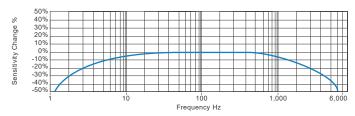

Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



Certifications













This product is certified in accordance with UL 913, 8th Ed. Rev. December 6, 2013 CAN/CSA C22.2 No. 157-92 (R2012) +Upd1 +Upd2



www.hansfordsensors.com sales@hansfordsensors.com



HS-420I/M Intrinsically Safe Accelerometer

4-20mA velocity output via 2 Pin MS Connector

Intrinsically Safe Requirements

Maximum Cable Length See website: www.hansfordsensors.com

see attached system drawings

Certificate details: Group I + II IECEx BAS08.0034X

Baseefa08ATEX0086X

®II 1GD

Ex ia IIC T6 Ga

Ex ia IIIC T80°C IP65 Da

⟨Ex | M1

Ex ia I Ma

 $(-40^{\circ}C \le Ta \le +60^{\circ}C)$

®II 1GD Certificate details: Group II Ex ia IIC T4 Ga

Ex ia IIIC T130°C IP65 Da

 $(-40^{\circ}C \le Ta \le +110^{\circ}C)$

Accelerometer System Certificate Baseefa08Y0087

Ex ia IIC T6 (-40°C \leq Ta \leq +60°C)

*On request - consult Sales Office

Terminal Parameters Ui = 28V, Ii = 115mA, Pi = 0.65W Group II

Ui = 16.5V Pi = 0.65W

or Ui = 28V Ii = 115mA Pi = 0.65W Group I

500V Isolation Units Will Pass A 500V Isolation Test

Certified Temperature Range Ex ia IIC T6 Ga (-40°C ≤ Ta ≤ +60°C) (Gas)

Ex ia IIC T4 Ga (- 40° C \leq Ta \leq + 110° C) (Gas)

Ex ia IIIC T80°C IP65 Da (-40°C \le Ta \le +60°C) (Dust)

Ex ia IIIC T130°C IP65 Da (-40°C \leq Ta \leq +110°C) (Dust)

Ex ia I Ma (-40° C \leq Ta \leq $+60^{\circ}$ C) (Mining)

IECEx ITA 10.0003X

Ex ia I Ma $(-40^{\circ}\text{C} \le \text{Ta} \le +60^{\circ}\text{C})$

South African Approval Certificate No. MASC MS/16-0229X

Group I and II (As Baseefa/ATEX)

US/Canada Approvals Certificate No. SGSNA/18/SUW/0000231 Class I, II, III, Division 1, 2, Groups A - G, T4, -40°C to +110°C,

Class I, Zone 0, AEx, ia, IIC, T4, Ga, -40°C to +110°C

Zone 20, AEx, ia, IIIC, T130°C, IP65, Da, -40°C to +110°C

Barrier 1 x Pepperl + Fuchs Galvanic Isolator KFD2-STC4-Ex1, which has superseded

> KFD2-CR-Ex1.30300 (BAS00ATEX7164) see attached system drawings

1 x MTL Zener Barrier MTL7787+ (BAS01ATEX7217)

or Pepperl + Fuchs Zener Barrier

Z787 (BAS01ATEX7005) or any other barrier that

conforms to system drawings attached

System Connections for Zener Barrier see attached system drawings

System Connections for Galvanic Isolator see attached system drawings

Terminal Parameters Ui = Vmax = 28V

> Ii = Imax = 115mA Pi = 0.65W


Notes: Special conditions of safe use for Group II dust.

The free end of the cable on the integral cable version of the apparatus must be terminated in an appropriately certified dust-proof enclosure.

The unit has no serviceable parts.

How To Order

Australia Approval Group 1

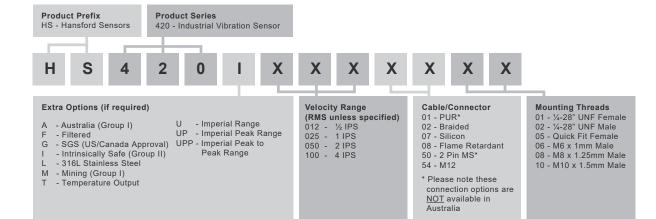



www.hansfordsensors.com sales@hansfordsensors.com



